

# ELECTRO INDUSTRIES - FIELD SERVICE BULLETIN

Bulletin Number 1082 Date December 31, 2003

Product Name Electro-Mate, EM-LV or EM-LD Series, after production

Effected Product Model Numbers:

	<b>Beginning ARL</b>	<b>Production Date</b>	<b>Ending ARL</b>	<b>Production Date</b>
EM-LV*****	1652	10-1-03	2301	1-15-04
EM-LD*****	1652	10-1-03	2300	1-15-04

## FIELD INFORMATION

**Blower may continue** to operate after completion of heat call (electric elements turn off).


To our knowledge this condition only applies to some "power robbing" electronic thermostats such as Honeywell T8400C.

- After the above production date, modification to control board solves problem.

Field suggestions, **when** this may occur:

1. Mechanical thermostat.
2. Battery operated thermostat.
3. Thermostat with its own common wire.
4. Add isolation relay between thermostat and "W" terminal.

Approval

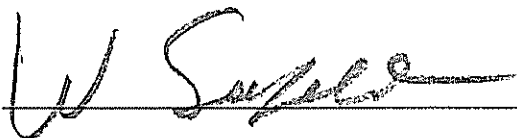

Date

1-20-04